DCR-TRV6/TRV6E/TRV11/ TRV11E/TRV20/TRV20E
RMT-808/809/811/812

SONY

SERVICE MANUAL

Level 2

Ver 1.3 2003. 06

US Model
Canadian Model
Korea Model
DCR-TRV6/TRV11/TRV20
AEP Model
UK Model
Australian Model
Chinese Model
DCR-TRV6E/TRV11E/TRV20E
E Model
Hong Kong Model
Tourist Model
DCR-TRV6/TRV6E/TRV11/ TRV11E/TRV20/TRV20E

SUPPLEMENT-1

File this supplement with the Service Manual. (PV03-001)

• Change of IC (Version up)

SECTION 5 ADJUSTMENTS

1. Before starting adjustment

1-1. Adjusting items when replacing main parts and boards.

: Supplied portion.

Page	FORMER	NEW
5-2	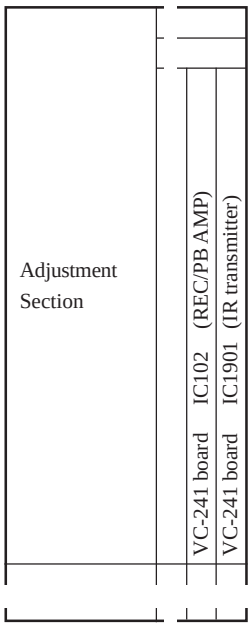	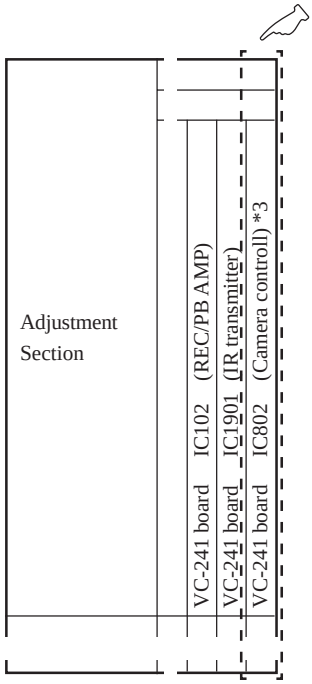

Supplied contents

5-3

*3: When IC802 of the VC-241 board is going to be exchanged, the data on page : E, address : 53 and the data 6F must be modified. Be sure to enter the following data without fail.

Input method:

1) Select page: 0, address: 01, and set data: 01.
2) Select page: E, address: 53, set data: 01, and press the PAUSE button.
3) Select page: E, address: 6F, set data: 82, and press the PAUSE button.
4) Select page: 0, address: 01, and set data: 00.

9-929-818-82

Sony EMCS Co.

2003F1600-1
©2003.6
Published by DI CS Strategy Div.